

PDA36A2 Si Switchable Gain Detector

User Guide



Table of Contents

Warning Symbol Definitions	1
Description	2
Setup	3
Operation	4
Theory of Operation	4
Responsivity	4
Dark Current	4
Bandwidth and Response	5
Terminating Resistance	5
Gain Adjustment	5
Troubleshooting	6
Specifications	7
Response Curve	9
Mechanical Drawing	10
Certificate of Conformance	11
Regulatory	12
Waste Treatment is Your Own Responsibility	12
Ecological Background	12
Thorlabs Worldwide Contacts	13
	Warning Symbol Definitions Description Setup Operation Theory of Operation Responsivity Dark Current Bandwidth and Response Terminating Resistance Gain Adjustment Troubleshooting Specifications Response Curve Mechanical Drawing Certificate of Conformance Regulatory Waste Treatment is Your Own Responsibility Ecological Background Thorlabs Worldwide Contacts

Chapter 1 Warning Symbol Definitions

Below is a list of warning symbols you may encounter in this manual or on your device.

Symbol	Description
	Direct Current
\sim	Alternating Current
\sim	Both Direct and Alternating Current
<u>_</u>	Earth Ground Terminal
	Protective Conductor Terminal
	Frame or chassis Terminal
$\stackrel{\triangle}{T}$	Equipotentiality
1	On (Supply)
0	Off (Supply)
	In Position of a Bi-Stable Push Control
П	Out Position of a Bi-Stable Push Control
4	Caution, Risk of Electric Shock
	Caution, Hot Surface
<u>^</u>	Caution, Risk of Danger
	Warning, Laser Radiation
A	Caution: ESD Sensitive Components

Chapter 2 Description

The PDA36A2 is an amplified, switchable-gain, Silicon (Si) detector designed for detection of light signals ranging from 350 to 1100 nm. An eight-position rotary switch allows the user to vary the gain in 10 dB steps. A buffered output drives 50 Ω load impedances up to 5 V. The PDA36A2 housing includes a removable threaded coupler (SM1T1) and retainer ring (SM1RR) that is compatible with any number of Thorlabs 1" threaded accessories. This allows convenient mounting of external optics, light filters, apertures, as well as providing an easy mounting mechanism using Thorlabs' cage assembly accessories.



ESD Caution



The components inside this instrument are ESD sensitive. Take all appropriate precautions to discharge personnel and equipment before making any electrical connections to the unit.

Page 2 TTN135069-D02

Chapter 3 Setup

The detector can be set up in many different ways using our extensive line of adapters. However, the detector should always be mounted and secured for best operation.

- Unpack the optical head, install a Thorlabs TR-series Ø1/2" or Ø25 mm post into one of the mounting holes, located on the bottom and side of the sensor, and mount using a PH-series post holder. Note that these detectors feature tapped holes that accept both 8-32 and M4 threads, so using either imperial or metric TR posts is possible.
- Connect the power supply 3-pin plug into the power receptacle on the PDA36A2.
- Plug the power supply into a 50 to 60Hz, 100 V / 120 V / 230 V power outlet.
- 4. Attach a 50 Ω coax cable (i.e. RG-58U) to the output of the PDA. When running cable lengths longer than 12" we recommend terminating the opposite end of the coax with a 50 Ω resistor (Thorlabs p/n T4119) for maximum performance. Connect the remaining end to a measurement device such as an oscilloscope or high speed DAQ card. Caution: Many high speed oscilloscopes have input impedances of 50 Ω . In this case, do not install a 50 Ω terminator. The combined loads will equal 25 Ω which could allow ~135 mA of output current. This will damage the output driver of the PDA36A2.
- Power the PDA36A2 on using the power switch located on the top side of the unit



Caution!




The PDA36A2 was designed to allow maximum accessibility to the photodetector by having the active area surface of the diode flush with the outside of the PDA housing. When using fiber adapters, make sure that the fiber ferrule does not crash into the detector. Failure to do so may cause damage to the diode and or the fiber.

- Install any desired filters, optics, adapters, or fiber adapters to the input aperture.
- 7. During alignment, take appropriate precautions, such as using reduced radiation power, or other precautions, and use proper eye and/or skin protection as recommended by the radiation source manufacturer.
- 8. Apply a light source to the detector. Adjust the gain to the desired setting.

Chapter 4 Operation

4.1. Theory of Operation

Thorlabs PDA series are ideal for measuring both pulsed and CW light sources. The PDA36A2 includes a reverse-biased PIN photo diode, mated to a switchable gain transimpedance amplifier, and packaged in a rugged housing.

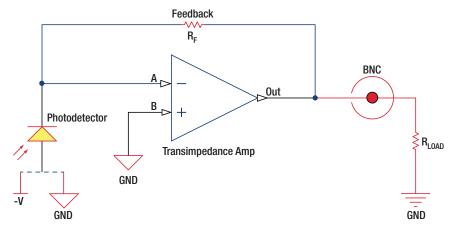

4.2. Responsivity

The responsivity of a photodiode can be defined as a ratio of generated photocurrent (IPD) to the incident light power (P) at a given wavelength:

$$R(\lambda) = \frac{I_{PD}}{P}$$

4.3. Dark Current

Dark current is leakage current which flows when a bias voltage is applied to a photodiode. The PDA with Transimpedance Amplifier does control the dark current flowing out. Looking at the figure above, it can be noted that Point B is held at ground and the amplifier will try to hold point A to "Virtual Ground". This minimizes the effects of dark current present in the system.

The dark current present is also affected by the photodiode material and the size of the active area. Silicon devices generally produce low dark current compared to germanium devices which have high dark currents. The table below lists several photodiode materials and their relative dark currents, speeds, sensitivity, and costs. Please note that sensitivity values in the table are typical values; Thorlabs offers photodetectors with sensitivity ranges that vary from those shown below.

Page 4 TTN135069-D02

Material	Dark Current	Speed	Sensitivity ¹ (nm)	Cost
Silicon (Si)	Low	High	400 – 1000	Low
Germanium (Ge)	High	Low	900 – 1600	Low
Gallium Phosphide (GaP)	Low	High	150 – 550	Med
Indium Gallium Arsenide (InGaAs)	Low	High	800 – 1800	Med
Extended Range: Indium Gallium Arsenide (InGaAs)	High	High	1200 – 2600	High

4.4. Bandwidth and Response

For the PDA detectors, the gain of the detector is dependent on the feedback element (R_f) . The bandwidth of the detector can be calculated using the following:

$$f(-3dB) = \sqrt{\frac{GBP}{4\pi R_f \times C_D}}$$

Where GBP is the amplifier gain bandwidth product and C_D is the sum of the photodiode junction capacitance and the amplifier capacitance.

4.5. Terminating Resistance

The maximum output of the PDA36A2 is 10 V for high impedance loads (i.e. RLoad > 5 k Ω) and 5 V for 50 Ω loads. Adjust the gain so that the measured signal level out of the PDA36A2 is below 10 V (5 V with a 50 Ω load) to avoid saturation.

For low terminating resistors, <5 k Ω or 1% error, an additional factor needs to be considered. The output of the PDA includes a 50 Ω series resistor (R_s). The output load creates a voltage divider with the 50 Ω series resistor as follows:

$$Scale\ Factor\ = \frac{R_{Load}}{R_{Load} + R_{S}}$$

 $V_{OUT} = \Re(\lambda) * Transimpedance Gain * Scale Factor * Input Power (W)$

4.6. Gain Adjustment

The PDA36A2 includes a low noise, low offset, high gain transimpedance amplifier that allows gain adjustment over a 70 dB range. The gain is adjusted by rotating the gain control knob, located on the top side of the unit. There are 8 gain positions incremented in 10 dB steps. It is important to note that the bandwidth will decrease as the gain increases. See the specifications table on page 7 to choose the best gain verse bandwidth for a given input signal.

Rev A. December 27, 2017

¹ Approximate values; actual wavelength values will vary.

Chapter 5 Troubleshooting

Problem	Suggested Solutions
	Verify that the power is switched on and all connections are secure.
There is no signal response.	Verify the proper terminating resistor is installed if using a Voltage measurement device.
	Verify that the optical signal wavelength is within the specified wavelength range.
	Verify that the optical signal is illuminating the detector active area.
Output Voltage will not increase.	Check to make sure the detector is not saturated. Refer to the Output Voltage spec. in the Specifications table.
Detector Output is skewed.	Install a 1" Lens Tube (SM1L10) to the thread coulpler (SM1T1) to baffle any external light sources to see if this improves the response.

Page 6 TTN135069-D02

Chapter 6 Specifications

All performance specifications are typical, performed at 25 $^{\circ}\text{C}$ ambient temperature, and assume a 50 Ω load, unless stated otherwise.

Performance Specifications ²			
0 dB Setting		40 dB Setting	
Gain (Hi-Z)	1.51 x 10 ³ V/A ±2%	Gain (Hi-Z)	1.51 x 10 ⁵ V/A ±2%
Gain (50 Ω)	0.75 x 10 ³ V/A ±2%	Gain (50 Ω)	0.75 x 10 ⁵ V/A ±2%
Bandwidth ³	12 MHz	Bandwidth ³	90 kHz
Noise (RMS)	258 μV	Noise (RMS)	214 μV
NEP (@ λ _p)	7.57 x 10 ⁻¹¹ W/√Hz	ΝΕΡ (@ λ _ρ)	3.25 x 10 ⁻¹² W/√Hz
Offset	±5 mV (Typ.) ±10 mV (Max)	Offset	±6 mV (Typ.) ±10 mV (Max)
10	dB Setting	50 dB Setting	
Gain (Hi-Z)	4.75 x 10 ³ V/A ±2%	Gain (Hi-Z)	4.75 x 10 ⁵ V/A ±2%
Gain (50 Ω)	2.38 x 10 ³ V/A ±2%	Gain (50 Ω)	2.38 x 10 ⁵ V/A ±2%
Bandwidth ³	1.6 MHz	Bandwidth ³	28 kHz
Noise (RMS)	192 μV	Noise (RMS)	234 μV
NEP (@ λ _p)	5.8 x 10 ⁻¹² W/√Hz	NEP (@ λ _p)	3.69 x 10 ⁻¹² W/√Hz
Offset	±6 mV (Typ.) ±10 mV (Max)	Offset	±6 mV (Typ.) ±10 mV (Max)
20	dB Setting	60 dB Setting	
Gain (Hi-Z)	1.5 x 10 ⁴ V/A ±2%	Gain (Hi-Z)	1.5 x 10 ⁶ V/A ±5%
Gain (50 Ω)	0.75 x 10 ⁴ V/A ±2%	Gain (50 Ω)	0.75 x 10 ⁶ V/A ±5%
Bandwidth ³	1 MHz	Bandwidth ³	9 kHz
Noise (RMS)	207 μV	Noise (RMS)	277 μV
NEP (@ λ _p)	3.4 x 10 ⁻¹² W/√Hz	NEP (@ λ _p)	4 x 10 ⁻¹² W/√Hz
Offset	±6 mV (Typ.) ±10 mV (Max)	Offset:	±6 mV (Typ.) ±10 mV (Max)
30	dB Setting	70	dB Setting
Gain (Hi-Z)	4.75 x 10 ⁴ V/A ±2%	Gain (Hi-Z)	4.75 x 10 ⁶ V/A ±5%
Gain (50 Ω)	2.38 x 10 ⁴ V/A ±2%	Gain (50 Ω)	2.38 x 10 ⁶ V/A ±5%
Bandwidth ³	260 kHz	Bandwidth ³	3 kHz
Noise (RMS)	211 μV	Noise (RMS)	388 μV
NEP (@ λ _p)	3.4 x 10 ⁻¹² W/√Hz	ΝΕΡ (@ λ _ρ)	4.29 x 10 ⁻¹² W/√Hz
Offset	±6 mV (Typ.) ±10 mV (Max)	Offset	±8 mV (Typ.) ±12 mV (Max)

² The PDA36A2 has a 50 Ω series terminator resistor (i.e. in series with amplifier output). This forms a voltage divider with any load impedance (e.g. 50 Ω load divides signal in half).

_

³ Tested at 650 nm wavelength. For NIR wavelengths, the rise time of the photodiode element will become slower which may limit the effective bandwidth of the amplified detector.

Electrical Specifications		
Detector	-	Si
Active Area	-	3.6 mm x 3.6 mm (13 mm ²)
Wavelength Range	λ	350 to 1100 nm
Peak Wavelength	λp	970 nm (Typ.)
Peak Response	$\Re(\lambda_p)$	0.65 A/W (Typ.)
Amplifier GBP	-	600 MHz
Output Impedance	-	50 Ω
Max Ouput Current	I _{out}	100 mA
Load Impedance	-	50 Ω to Hi-Z
Gain Adjustment Range	- 0 dB to 70 dB	
Gain Steps	-	8 x 10 dB Steps
Output Voltage	V _{OUT}	0 to 5 V (50 Ω) 0 to 10 V (Hi-Z)


General		
On/Off Switch	Slide	
Gain Switch	8 Position Rotary	
Output	BNC (DC Coupled)	
Package Size	2.79" x 1.96" x 0.89" (70.9 mm x 49.8 mm x 22.5 mm)	
PD Surface Depth⁴	0.09" (2.2 mm)	
Weight, Detector Only	0.10 kg	
Accessories	SM1T1 Coupler SM1RR Retainer Ring	
Operating Temp	10 to 40 °C	
Storage Temp	-20 to 70 °C	
AC Power Supply	AC – DC Converter	
Input Power⁵	31 W 100 V / 120 V / 230 V, 50 – 60 Hz	

Page 8 TTN135069-D02


⁴ Measured from the active area to the start of the threads on the housing body. The detector active area surface is flush with the front of the housing body.

⁵ Although the power supply is rated for 31 W the PDA36A2 actual usage is <5 W over the full operating range.

6.1. Response Curve

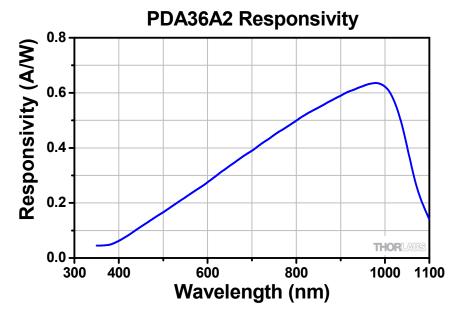

6.2. Mechanical Drawing

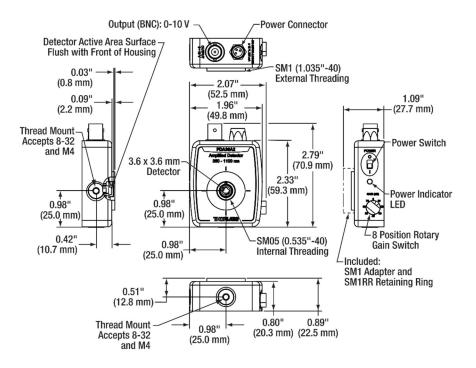

Page 10 *TTN135069-D02*

Chapter 7 Certificate of Conformance



EU Declaration of Conformity

in accordance with EN ISO 17050-1:2010

We: Thorlabs Inc.

Of: 56 Sparta Avenue, Newton, New Jersey, 07860, USA

in accordance with the following Directive(s):

2014/35/EU Low Voltage Directive (LVD)

2014/30/EU Electromagnetic Compatibility (EMC) Directive

2011/65/EU Restriction of Use of Certain Hazardous Substances (RoHS)

hereby declare that:

Model: PDA05CF2, PDA100A2, PDA10A2, PDA10CS2, PDA10D2, PDA20CS2, PDA25K2,

PDA30B2, PDA36A2, PDA50B2, PDA8A2, PDA20C2

Equipment: Switchable adjustable and Non-switchable fixed gain Amplified Photodetector

is in conformity with the applicable requirements of the following documents:

EN 61010-1 Safety Requirements for Electrical Equipment for Measurement, Control and 2010

Laboratory Use.

EN 61326-1 Electrical Equipment for Measurement, Control and Laboratory Use - EMC 2013

Requirements

and which, issued under the sole responsibility of Thorlabs, is in conformity with Directive 2011/65/EU of the European Parliament and of the Council of 8th June 2011 on the restriction of the use of certain hazardous substances in electrical and electronic equipment, for the reason stated below:

does not contain substances in excess of the maximum concentration values tolerated by weight in homogenous materials as listed in Annex II of the Directive

I hereby declare that the equipment named has been designed to comply with the relevant sections of the above referenced specifications, and complies with all applicable Essential Requirements of the Directives.

Signed: On: 09 January 2018

Name: Ann Strachan

Position: Compliance Manager EDC - PDA 05CF2, PDA 100A2, PDA 10A2, P.

Chapter 8 Regulatory

As required by the WEEE (Waste Electrical and Electronic Equipment Directive) of the European Community and the corresponding national laws, Thorlabs offers all end users in the EC the possibility to return "end of life" units without incurring disposal charges.

- This offer is valid for Thorlabs electrical and electronic equipment:
- Sold after August 13, 2005
- Marked correspondingly with the crossed out "wheelie bin" logo (see right)
- Sold to a company or institute within the EC
- Currently owned by a company or institute within the EC
- Still complete, not disassembled and not contaminated



Wheelie Bin Logo

As the WEEE directive applies to self contained operational electrical and electronic products, this end of life take back service does not refer to other Thorlabs products, such as:

- Pure OEM products, that means assemblies to be built into a unit by the user (e.g. OEM laser driver cards)
- Components
- Mechanics and optics
- Left over parts of units disassembled by the user (PCB's, housings etc.).

If you wish to return a Thorlabs unit for waste recovery, please contact Thorlabs or your nearest dealer for further information.

Waste Treatment is Your Own Responsibility

If you do not return an "end of life" unit to Thorlabs, you must hand it to a company specialized in waste recovery. Do not dispose of the unit in a litter bin or at a public waste disposal site.

Ecological Background

It is well known that WEEE pollutes the environment by releasing toxic products during decomposition. The aim of the European RoHS directive is to reduce the content of toxic substances in electronic products in the future.

The intent of the WEEE directive is to enforce the recycling of WEEE. A controlled recycling of end of life products will thereby avoid negative impacts on the environment.

Page 12 TTN135069-D02

Chapter - Thorlabs Worldwide Contacts

USA, Canada, and South America

Thorlabs, Inc. 56 Sparta Avenue Newton, NJ 07860 USA

Tel: 973-300-3000 Fax: 973-300-3600 www.thorlabs.com

www.thorlabs.us (West Coast) Email: sales@thorlabs.com

Support: techsupport@thorlabs.com

Europe

Thorlabs GmbH Hans-Böckler-Str. 6 85221 Dachau / Munich Germany

Tel: +49-(0) 8131-5956-0 Fax: +49-(0) 8131-5956-99

www.thorlabs.de

Email: europe@thorlabs.com

France

Thorlabs SAS 109, rue des Côtes 78600 Maisons-Laffitte France

Tel: +33 (0) 970 444 844 Fax: +33 (0) 825 744 800 www.thorlabs.com

Email: sales.fr@thorlabs.com

Japan

Thorlabs Japan, Inc. 3-6-3, Kitamachi, Nerima-ku, Tokyo 179-0081 Japan

Tel: +81-3-6915-7701 Fax: +81-3-6915-7716 www.thorlabs.co.jp Email: sales@thorlabs.jp

UK and Ireland

Thorlabs Ltd. 1 Saint Thomas Place Ely CB7 4EX Great Britain

Tel: +44 (0) 1353-654440 Fax: +44 (0) 1353-654444

www.thorlabs.com Email: sales.uk@thorlabs.com

Support: techsupport.uk@thorlabs.com

Scandinavia

Thorlabs Sweden AB Bergfotsgatan 7 431 35 Mölndal Sweden

Tel: +46-31-733-30-00 Fax: +46-31-703-40-45 www.thorlabs.com

Email: scandinavia@thorlabs.com

Brazil

Thorlabs Vendas de Fotônicos Ltda. Rua Riachuelo, 171 São Carlos, SP 13560-110 Brazil

Tel: +55-16-3413 7062 Fax: +55-16-3413 7064 www.thorlabs.com Email: brasil@thorlabs.com

China

Thorlabs China Room A101, No. 100, Lane 2891, South Qilianshan Road Putuo District Shanghai 200331 China

Tel: +86 (0) 21-60561122 Fax: +86 (0) 21-32513480 www.thorlabschina.cn Email: chinasales@thorlabs.com



